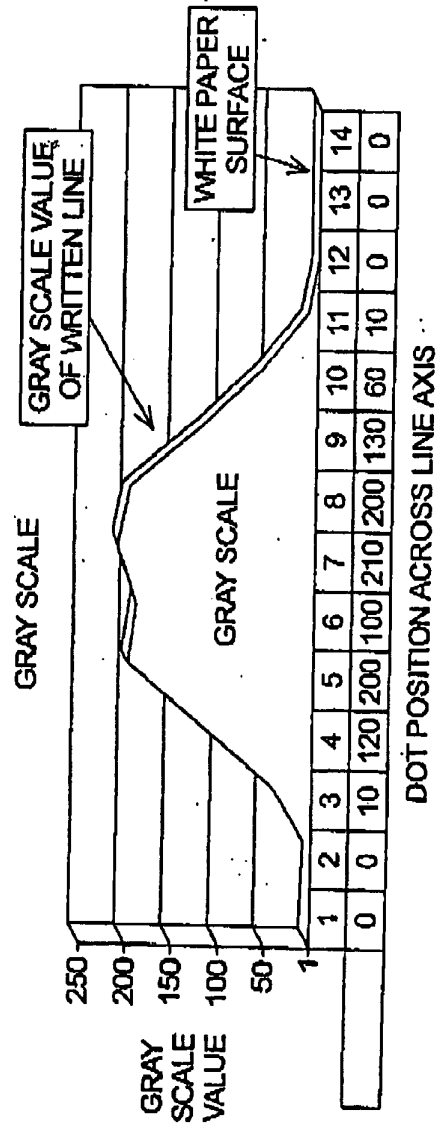


FIG. 2



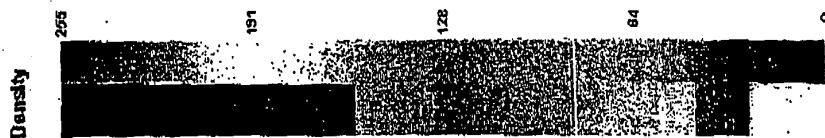


FIG. 3



Images Copyright by Limbic Systems Inc.



FIG. 4

FIG. 5

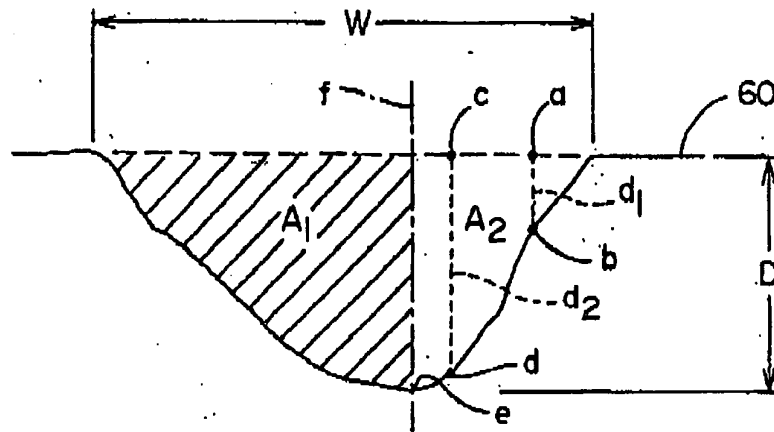


FIG. 6

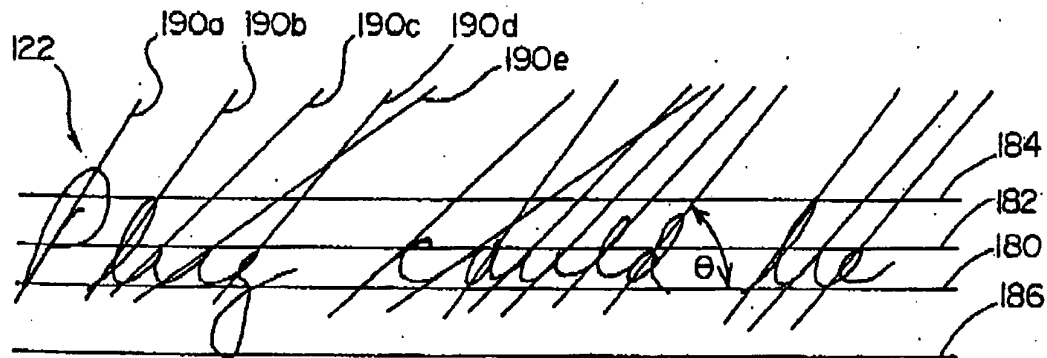


FIG. 7

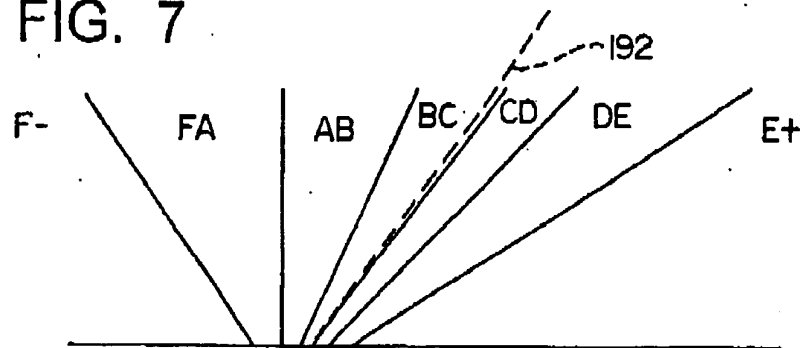
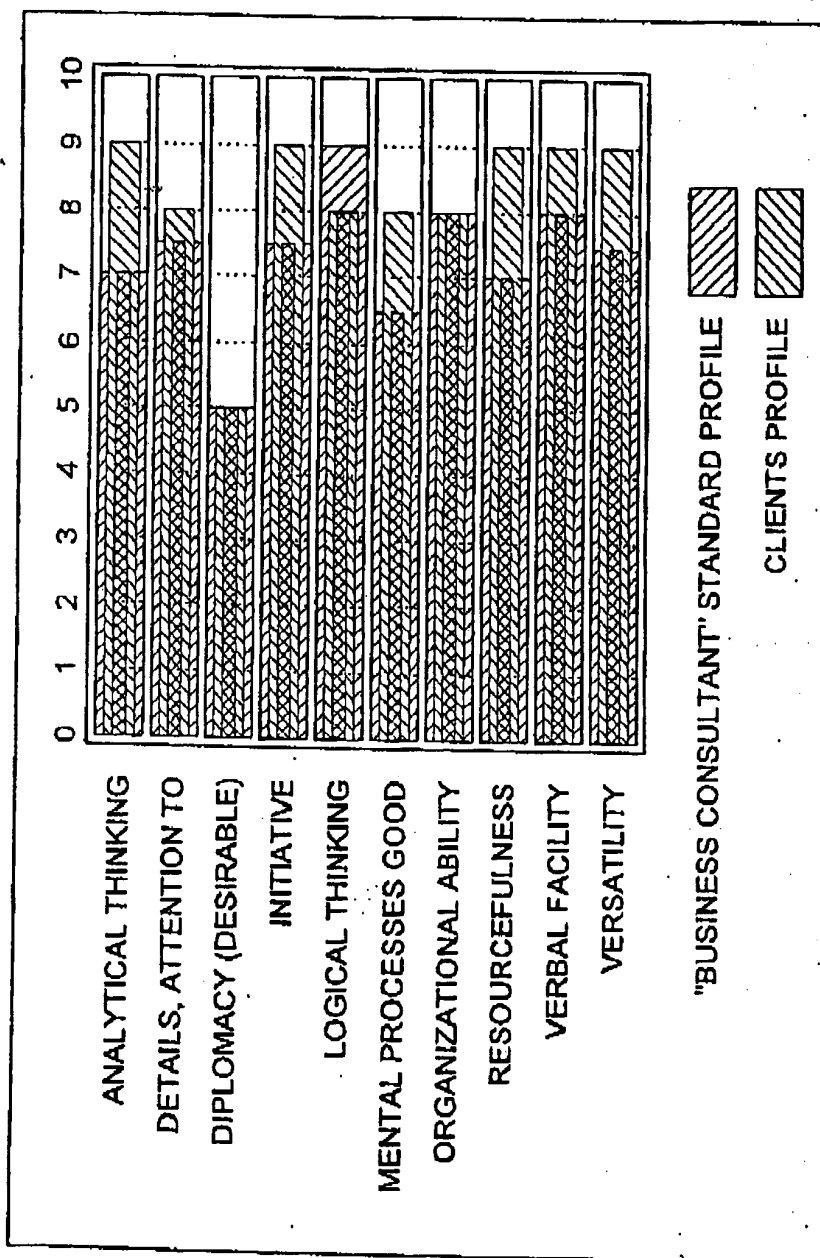


FIG. 10

TRAIT PROFILE COMPARISON
FOR _____ CLIENT AS "BUSINESS CONSULTANT"

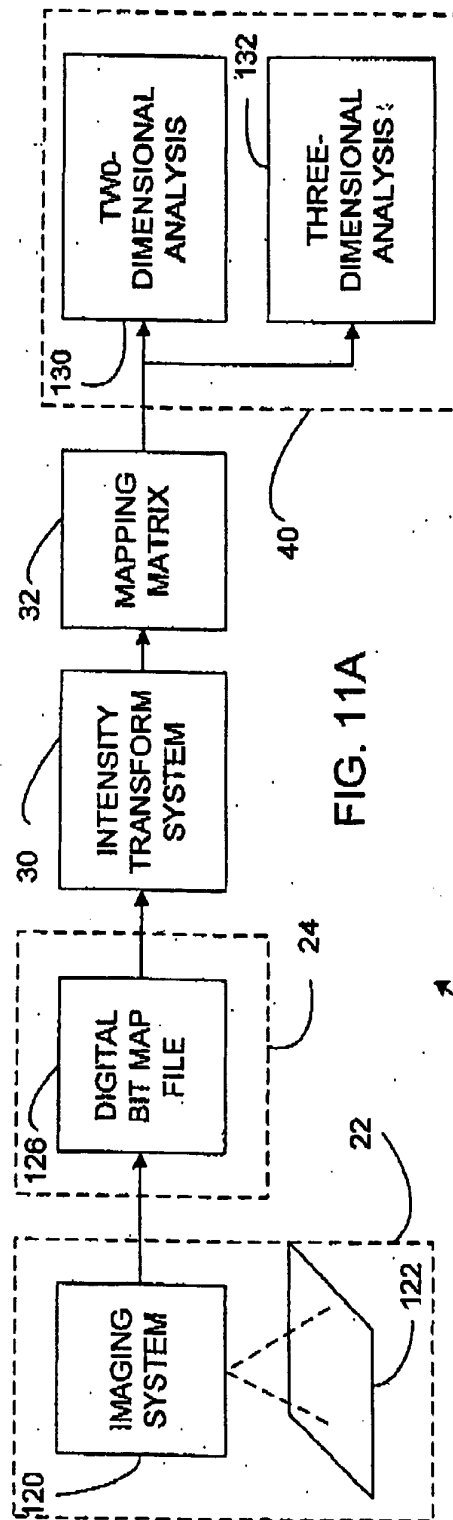


FIG. 11A

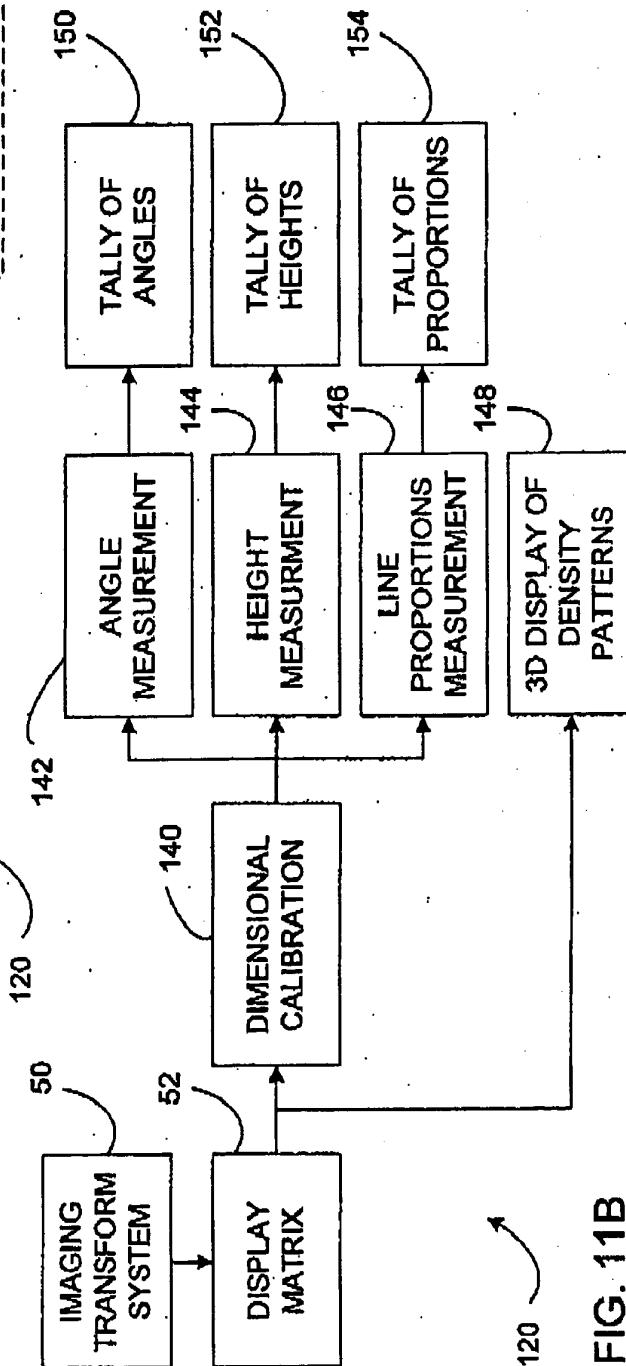


FIG. 11B

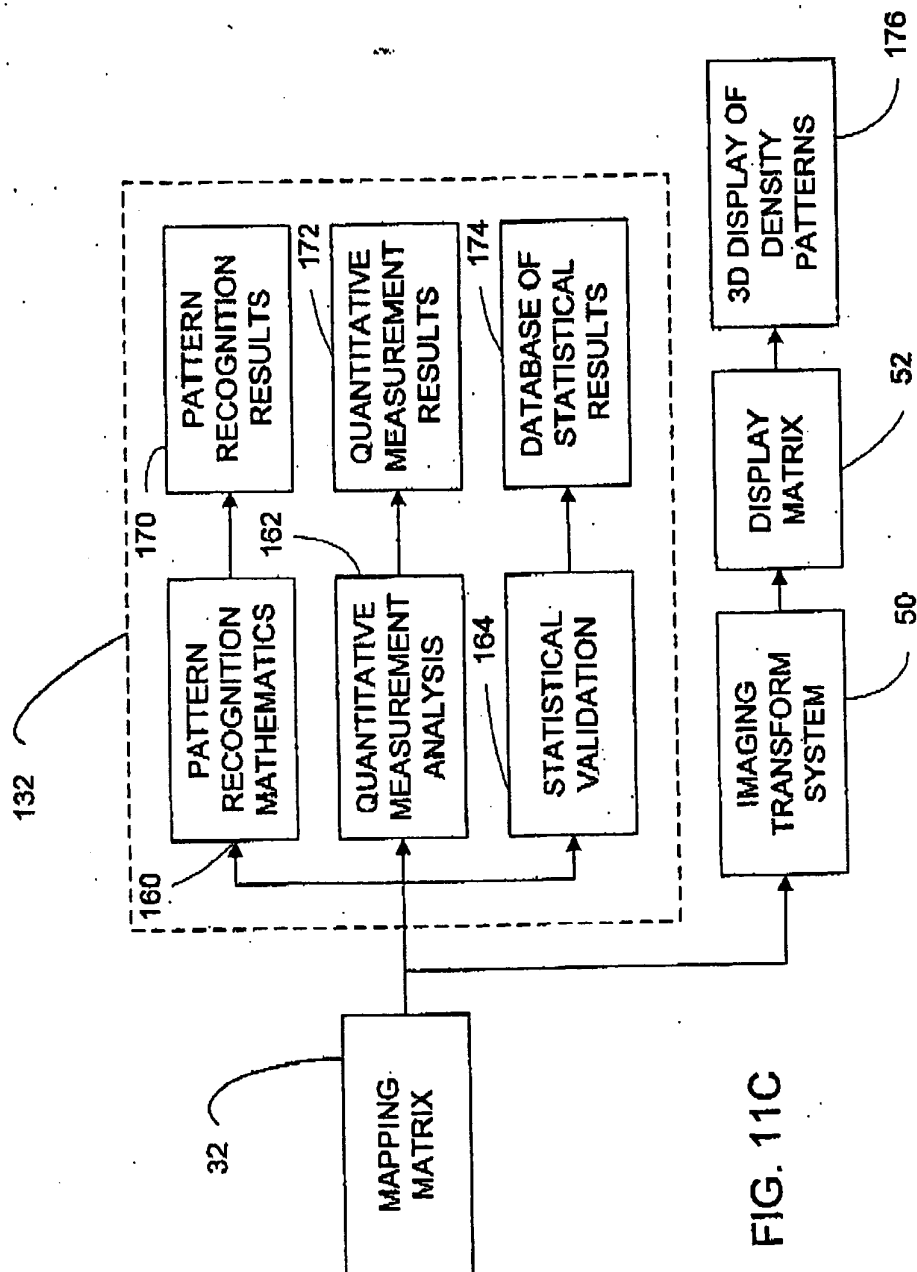
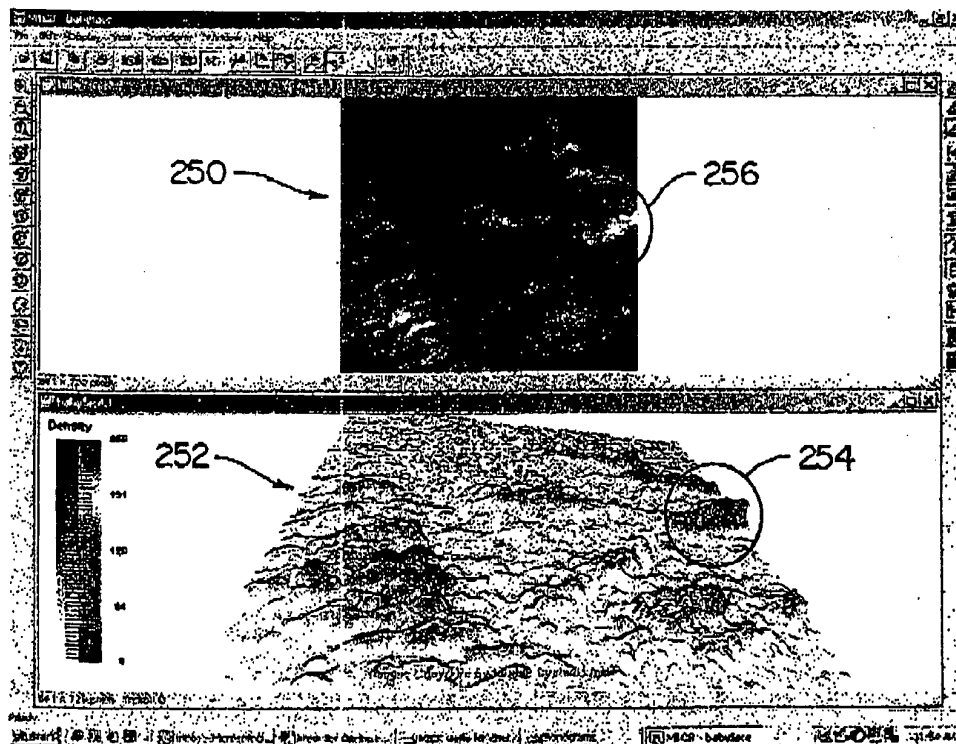
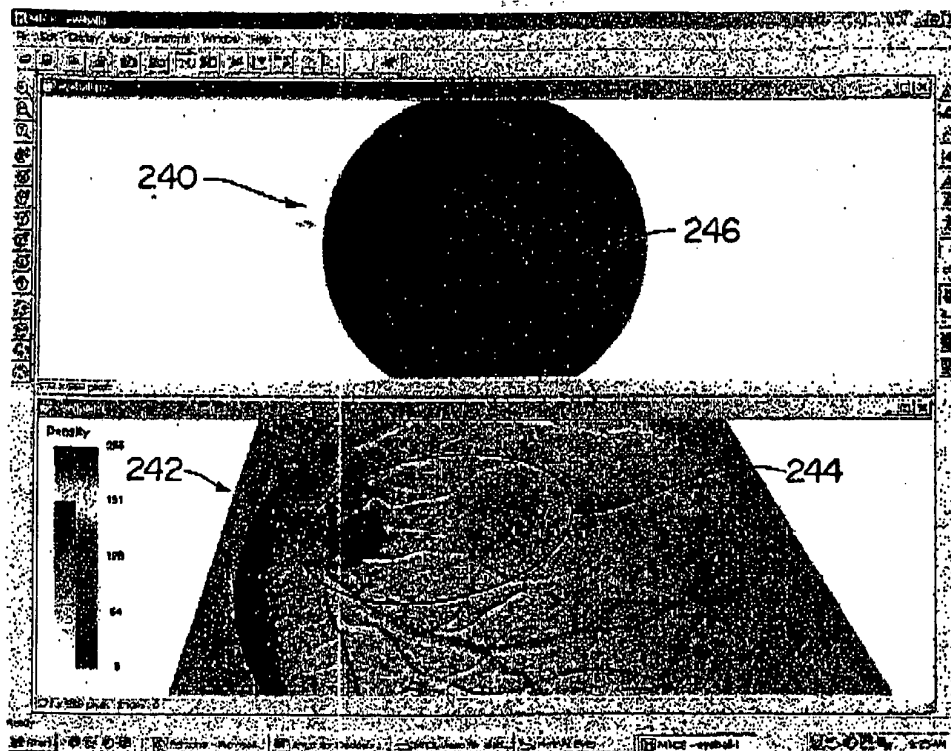
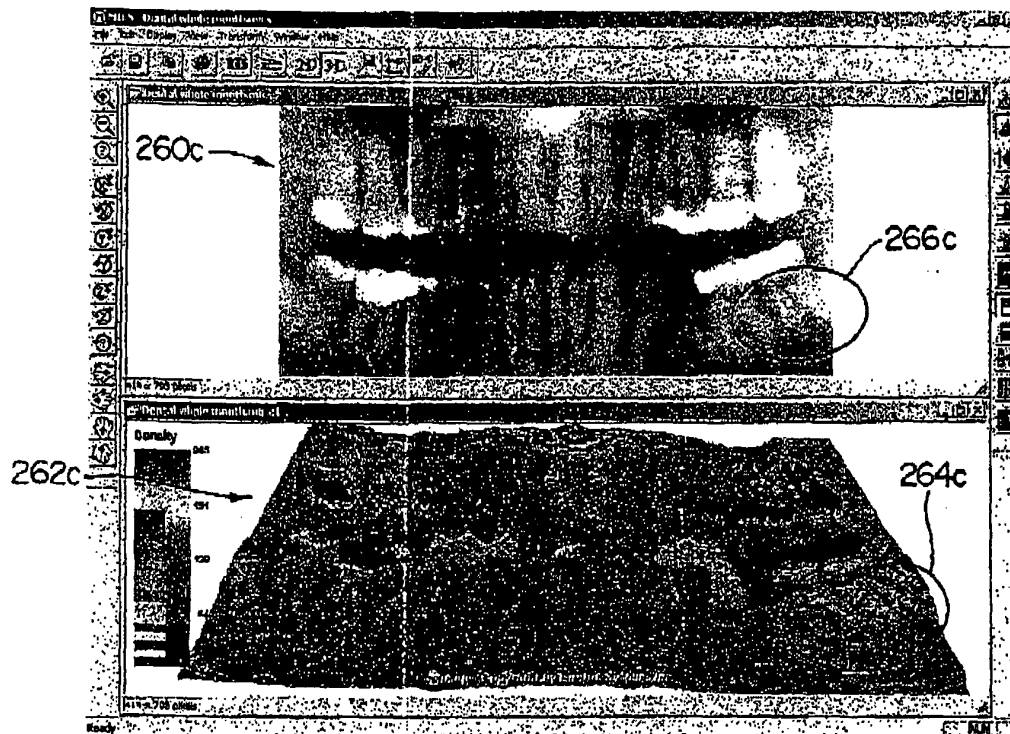
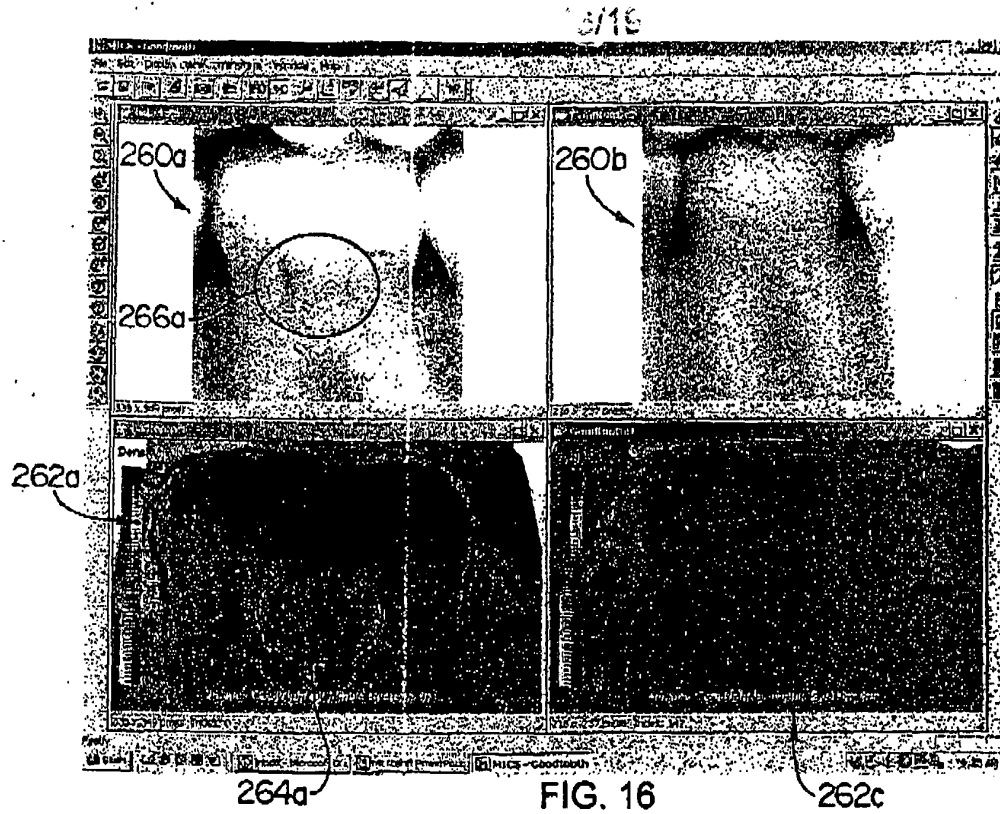
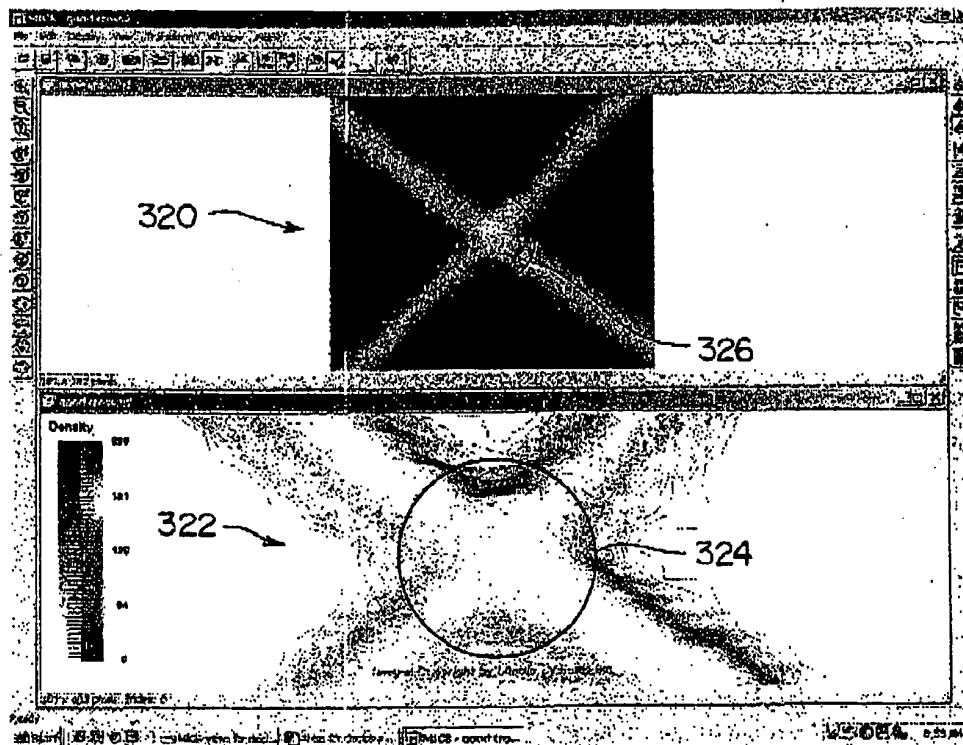
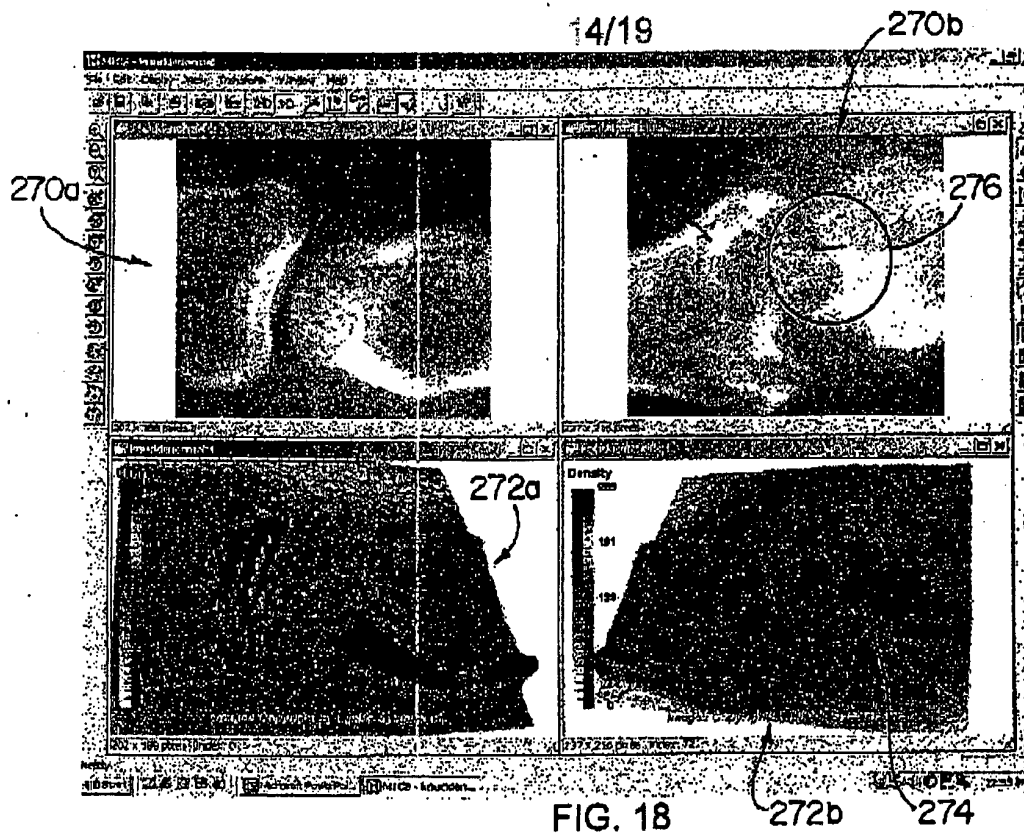


FIG. 11C







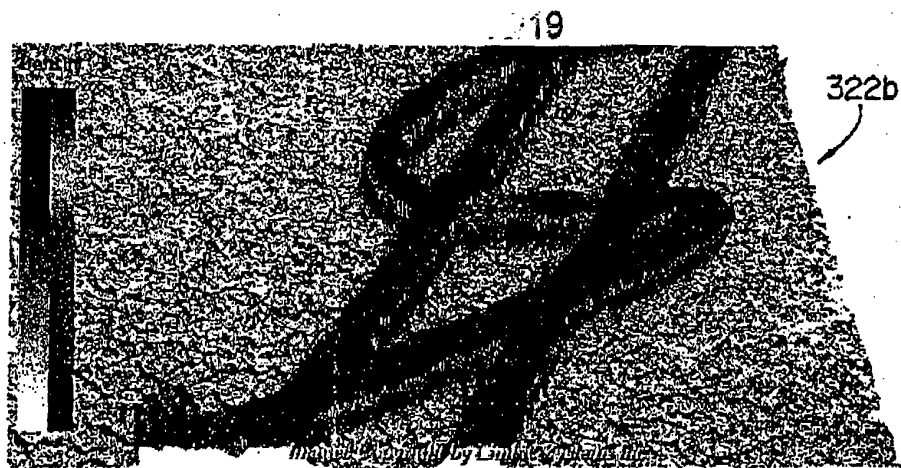


FIG. 20

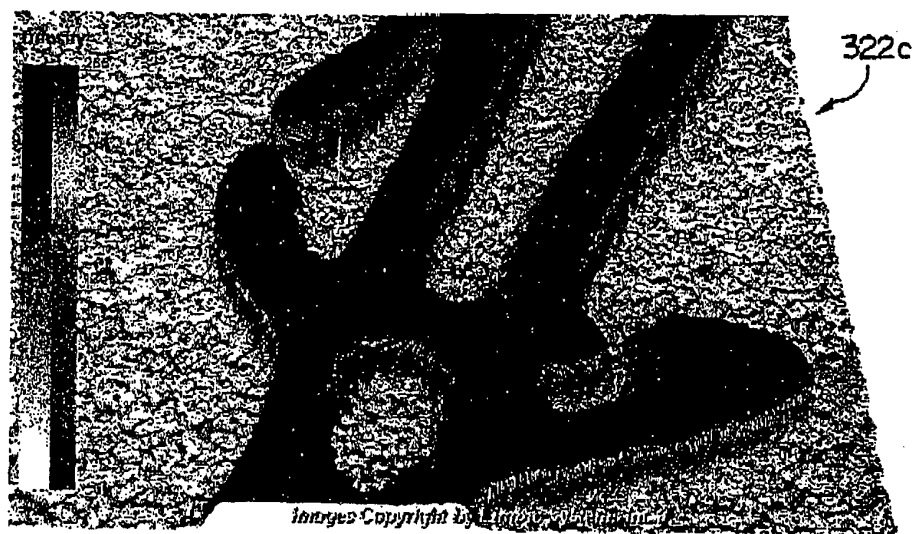


FIG. 21

16/19

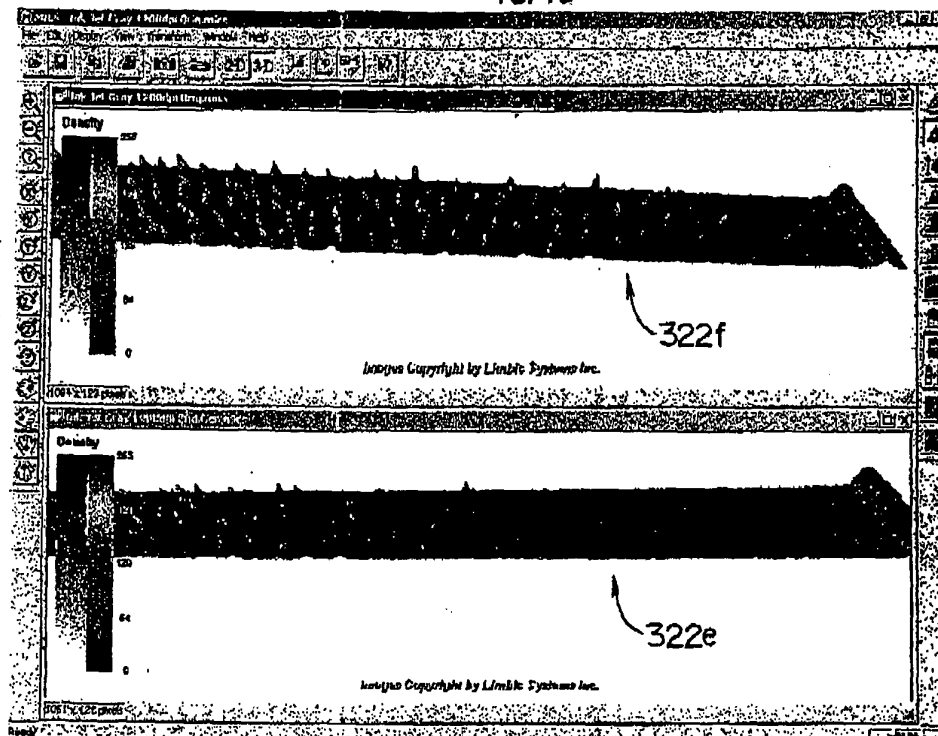


FIG. 22

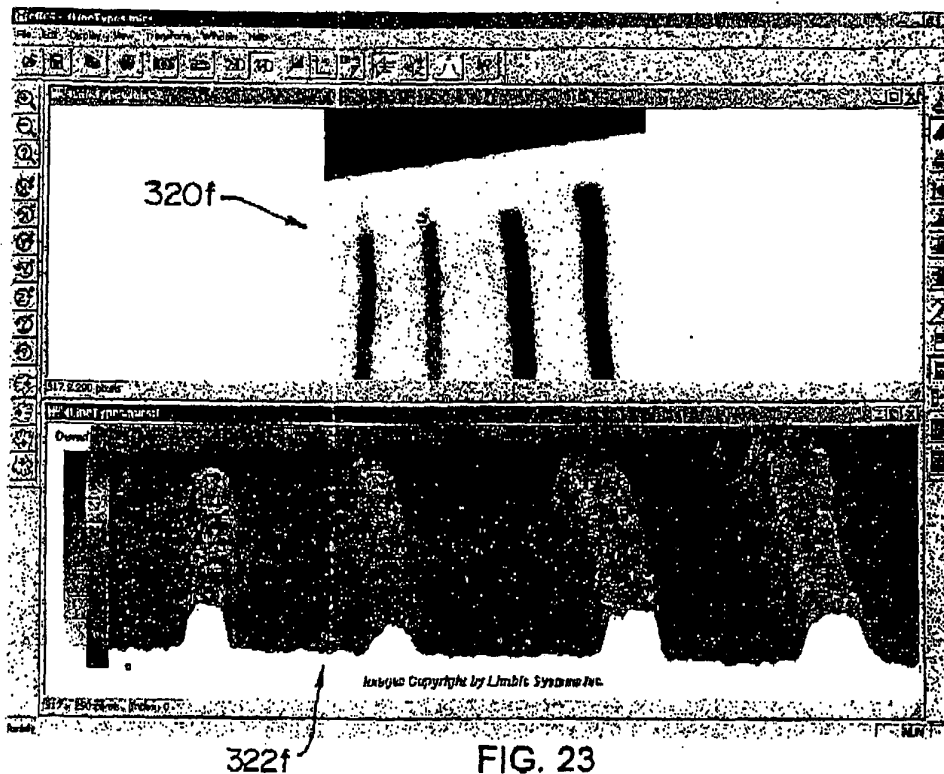


FIG. 23

17:19

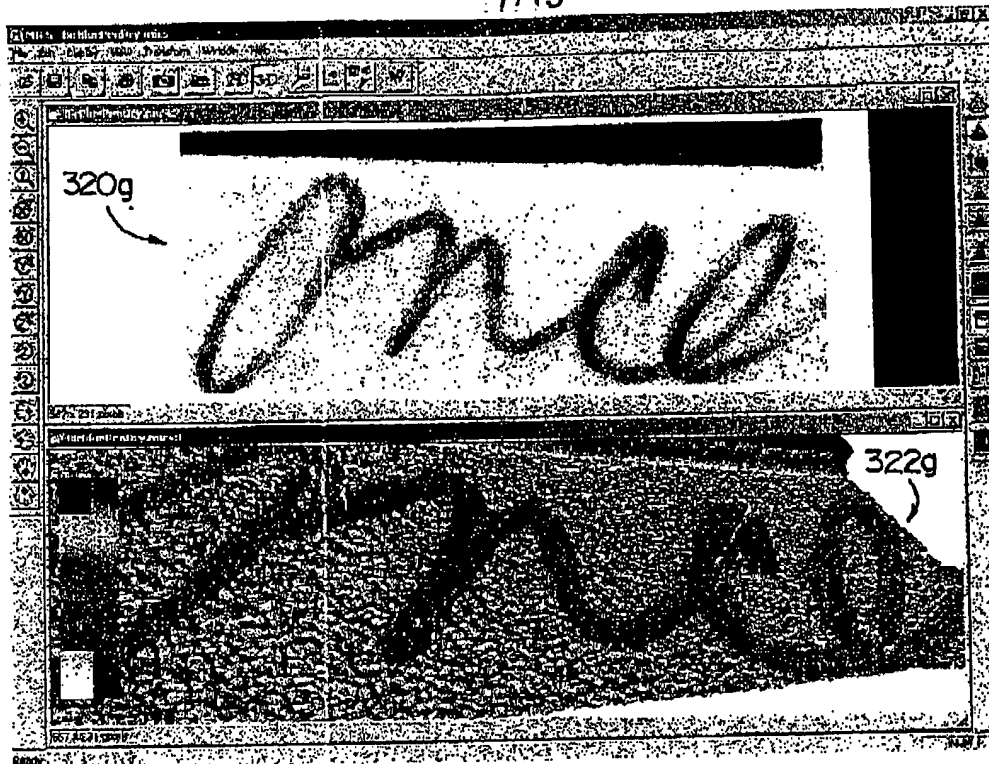


FIG. 24

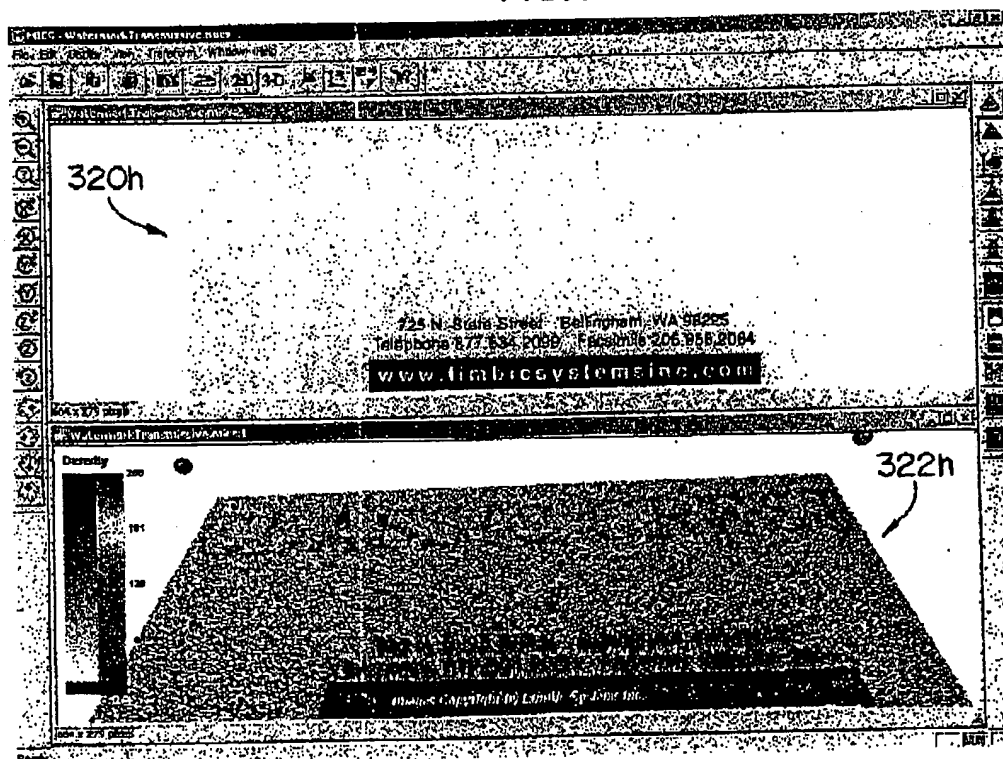
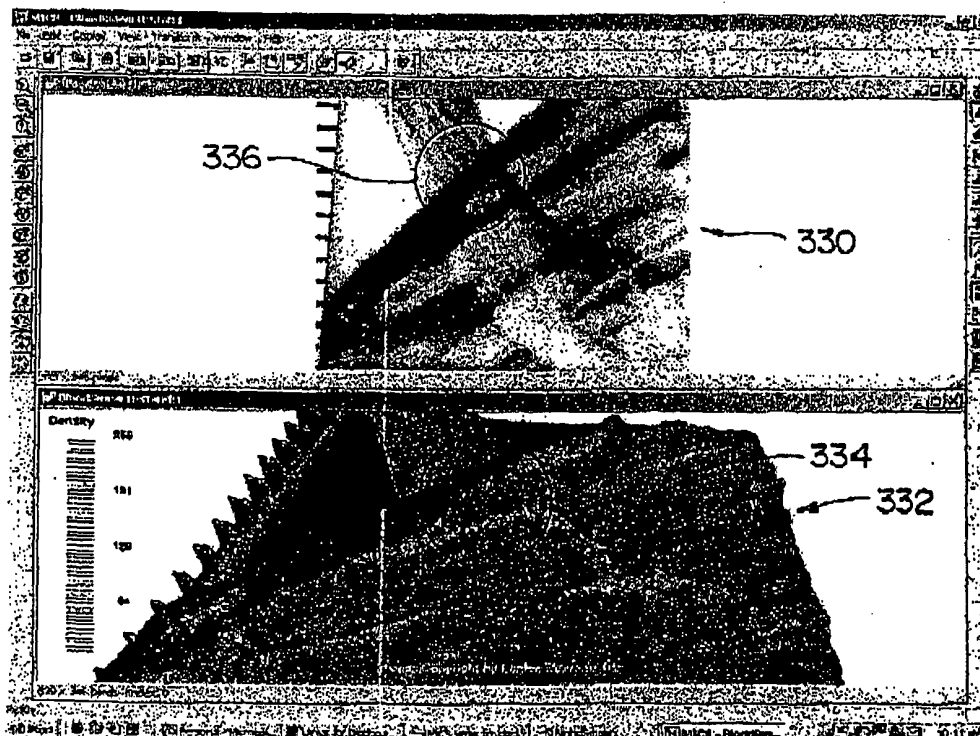
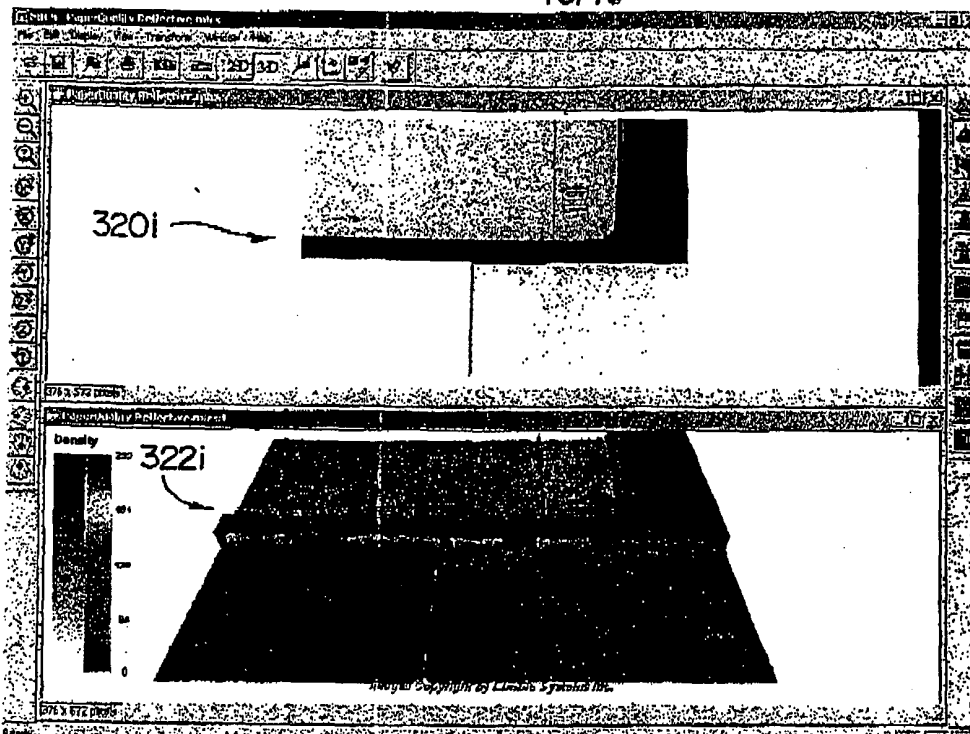


FIG. 25

18/19



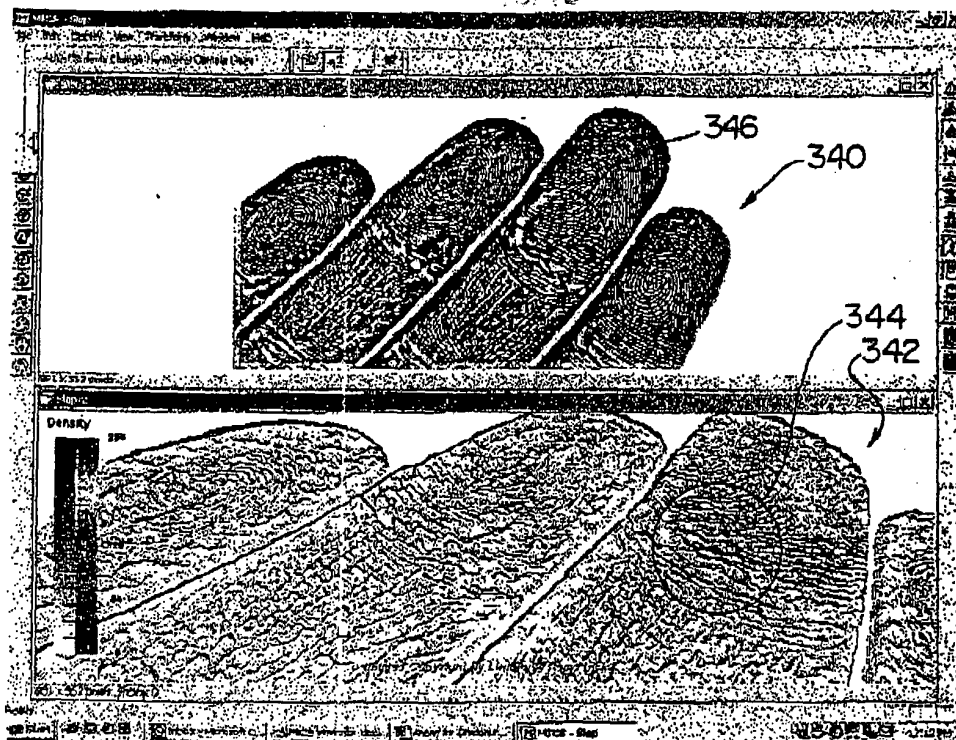


FIG. 28

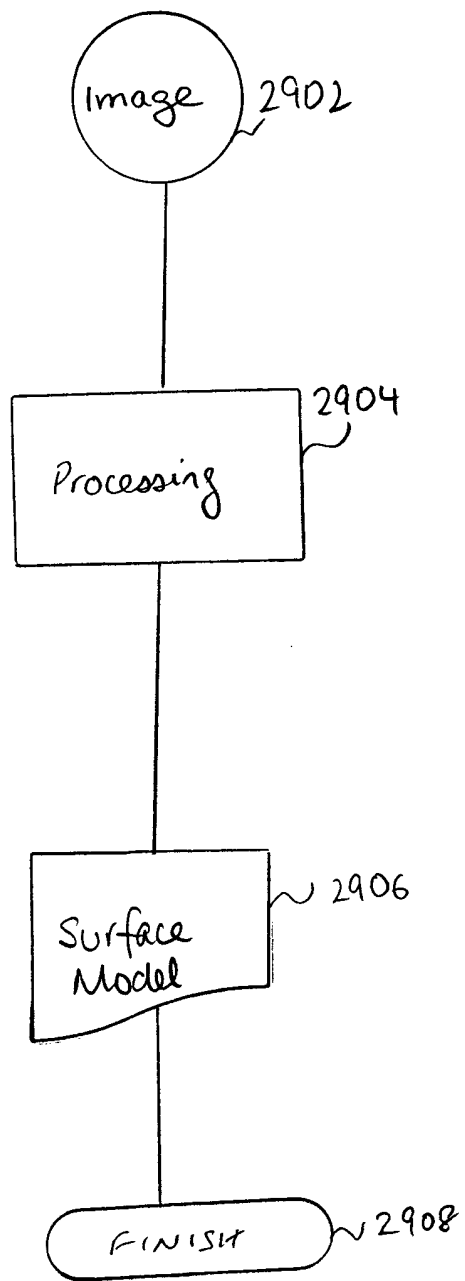


FIG. 29

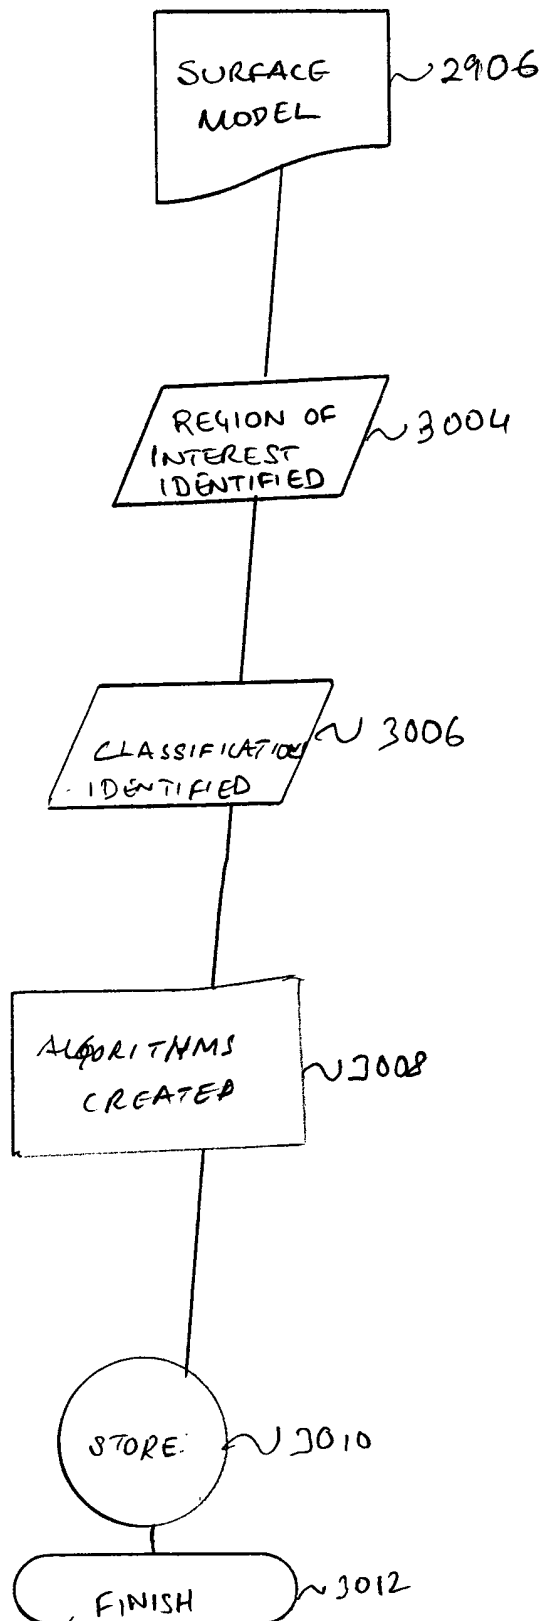


FIG. 30

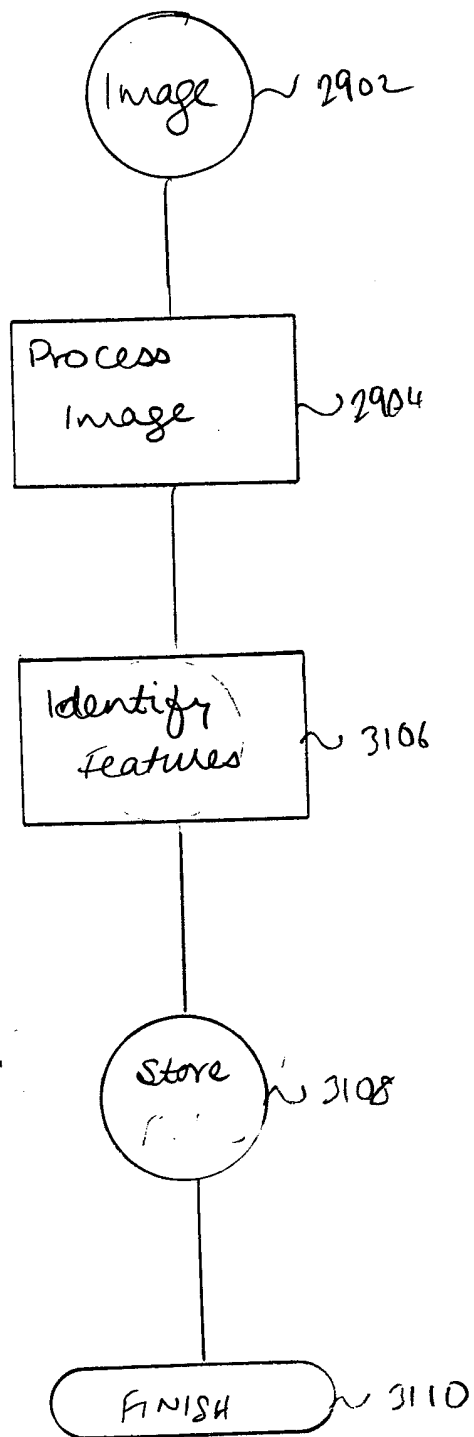


FIG. 31.

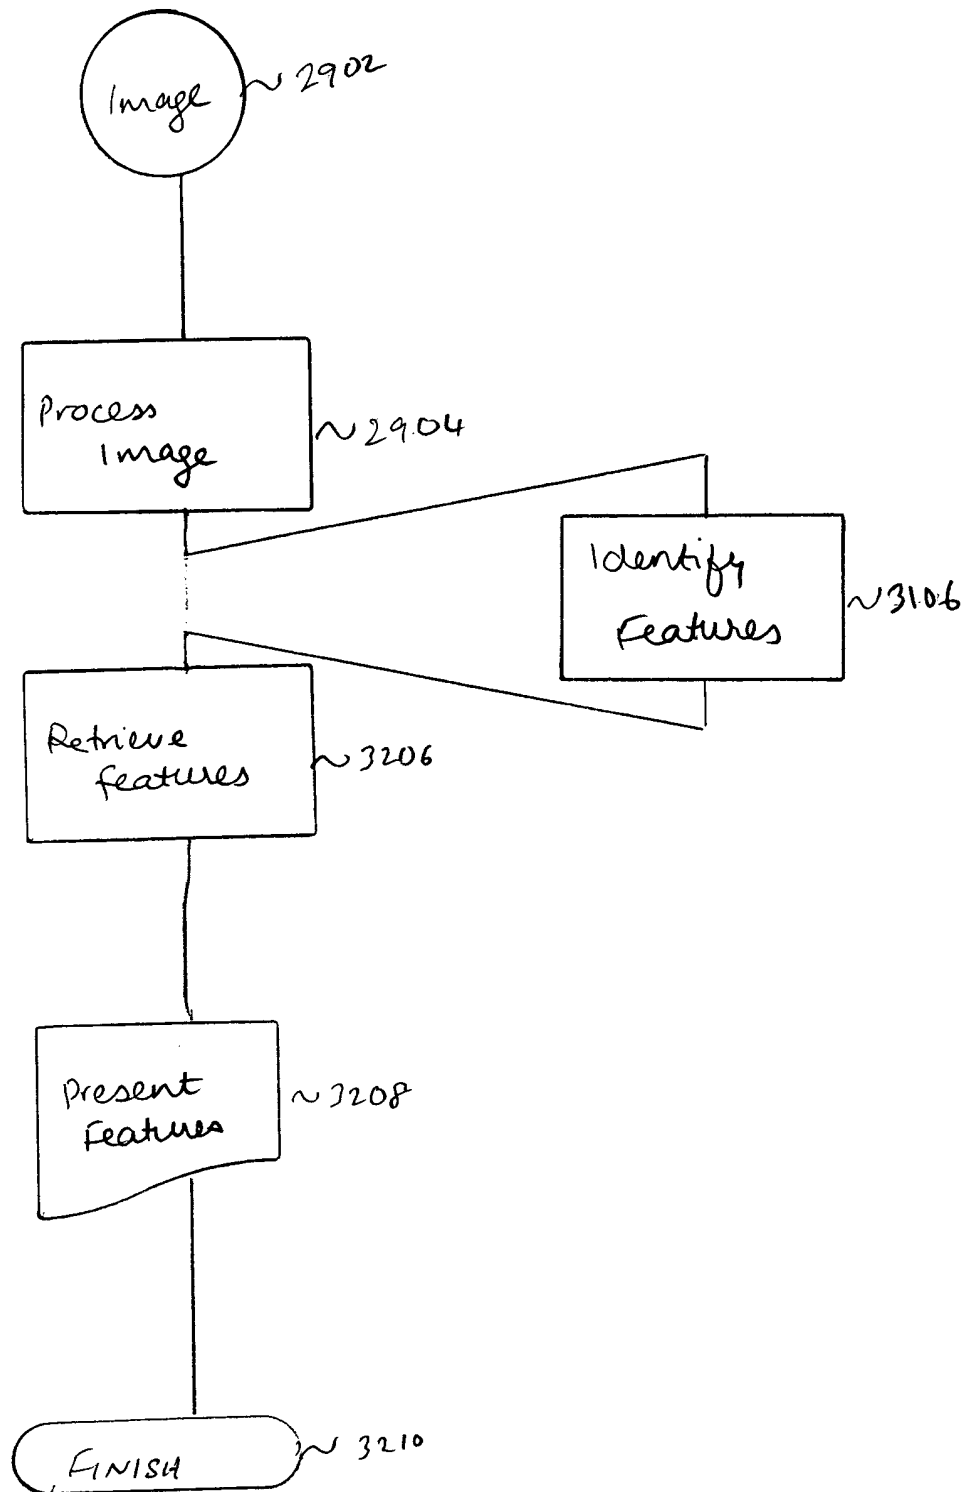


FIG. 32



FIG. 33



FIG. 34


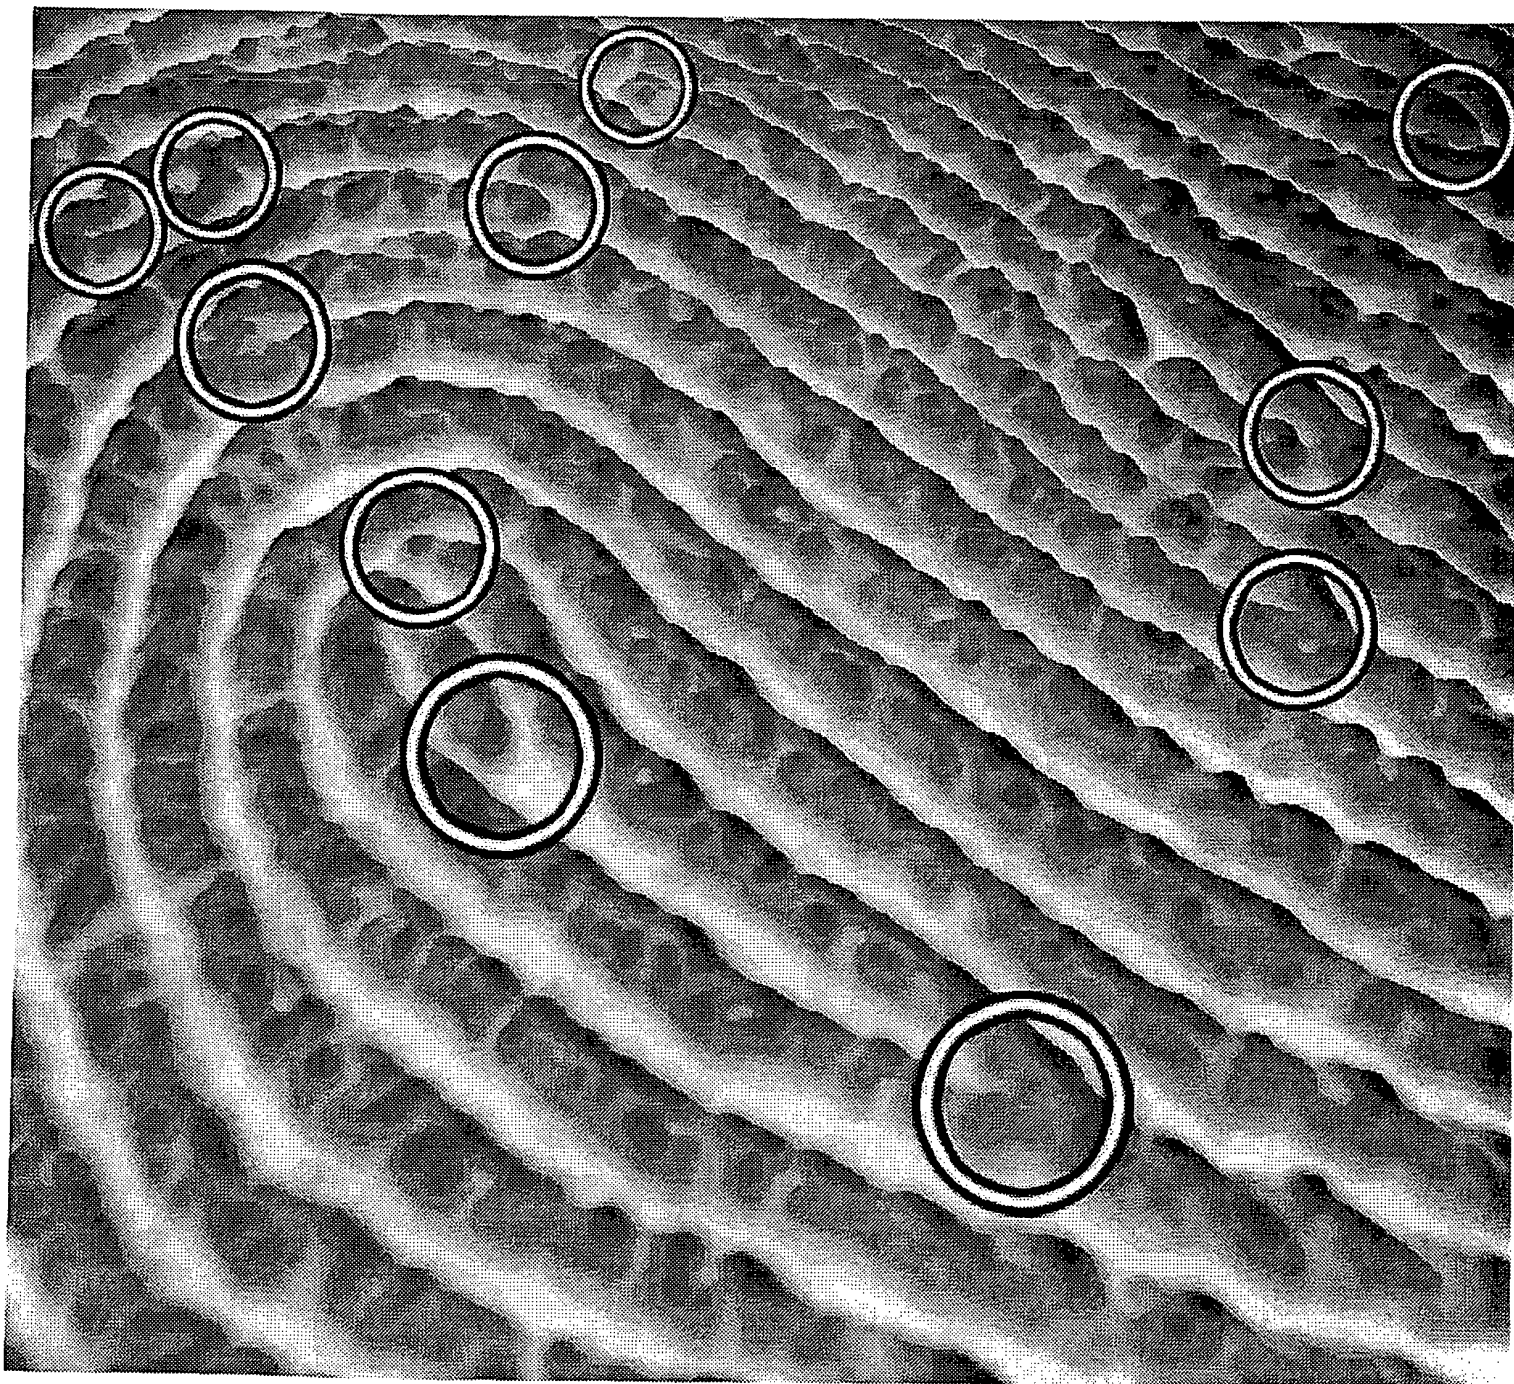


Fig. 35

Grayscale Image of butt weld in one quarter inch flat steel plate. A visible Lack of Fusion defect shows as a darker linear region near the edge of the lighter appearing weld metal.

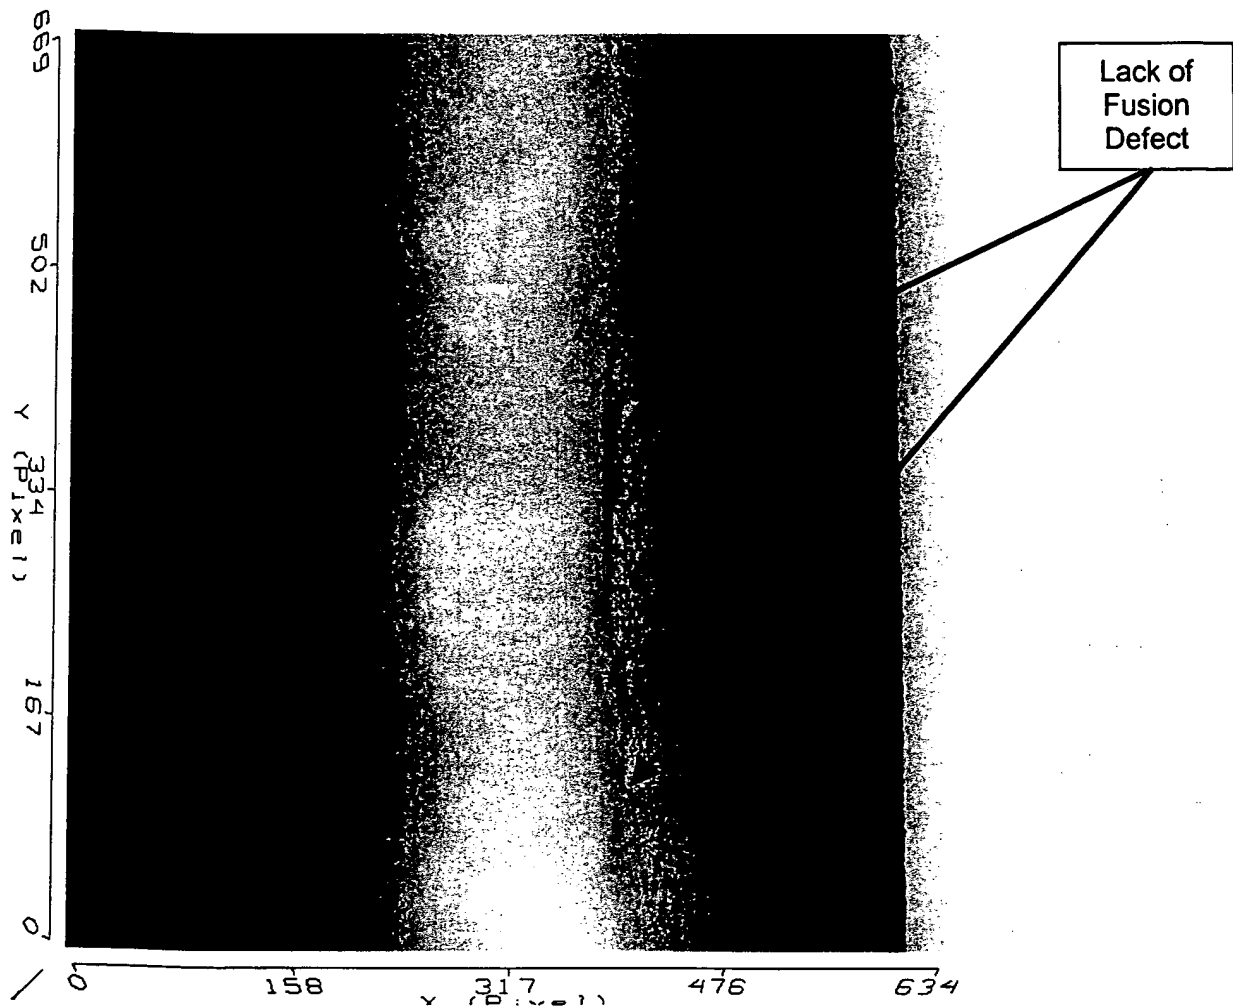

The same welded plate image rendered as a 3D surface with pseudo-colors added. The Lack of Fusion defect appears to the right of the central "peak" of weld metal deposit. The image has been rotated to give a sense of the 3D nature of the surface.




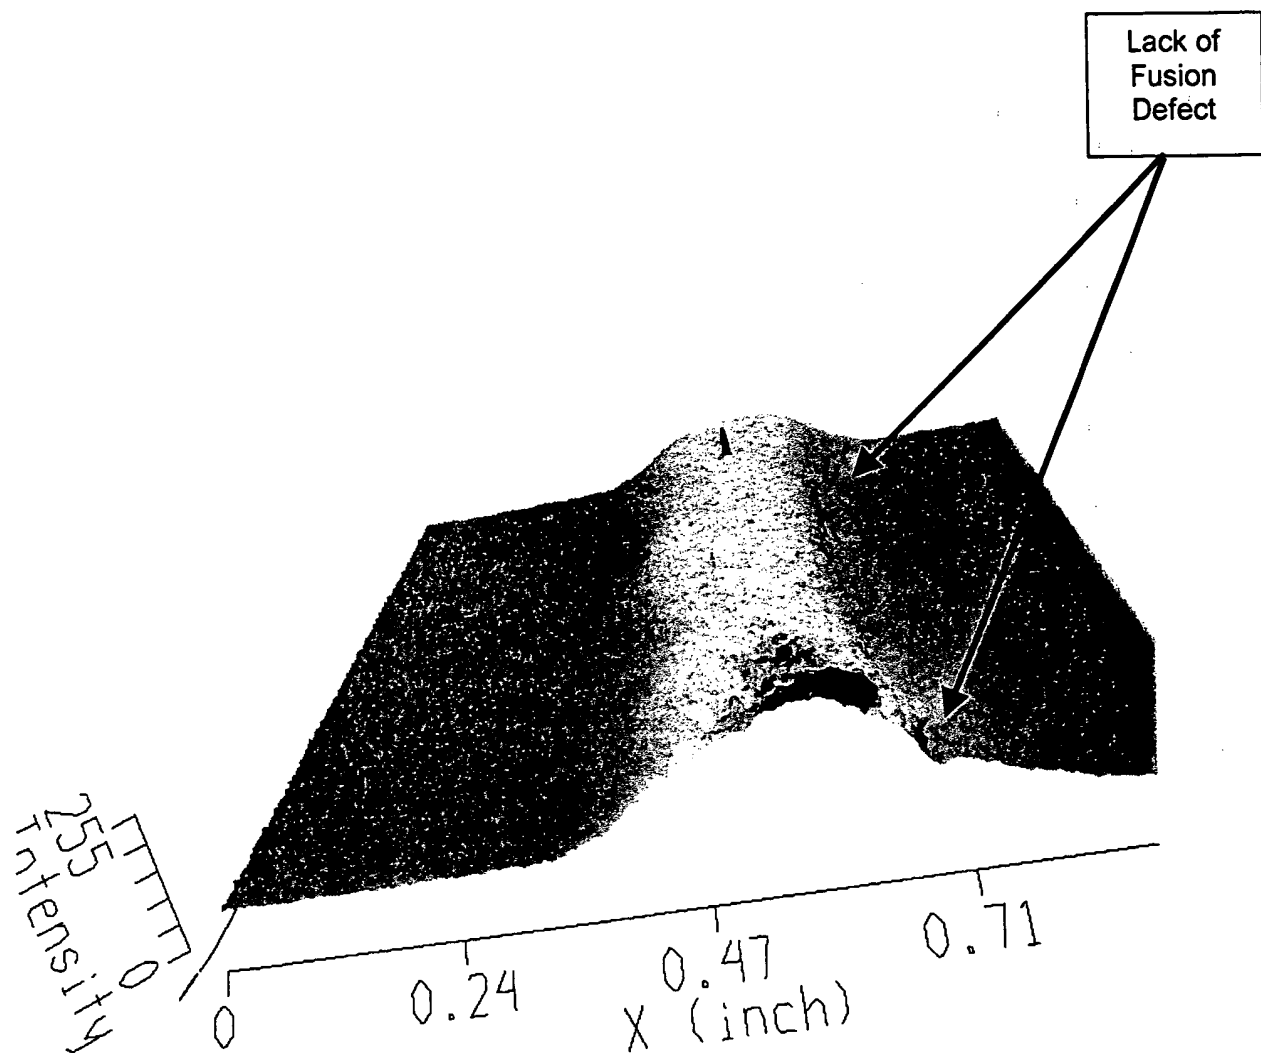




FIG. 37

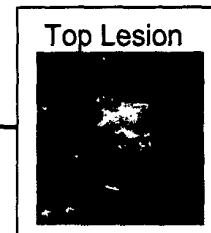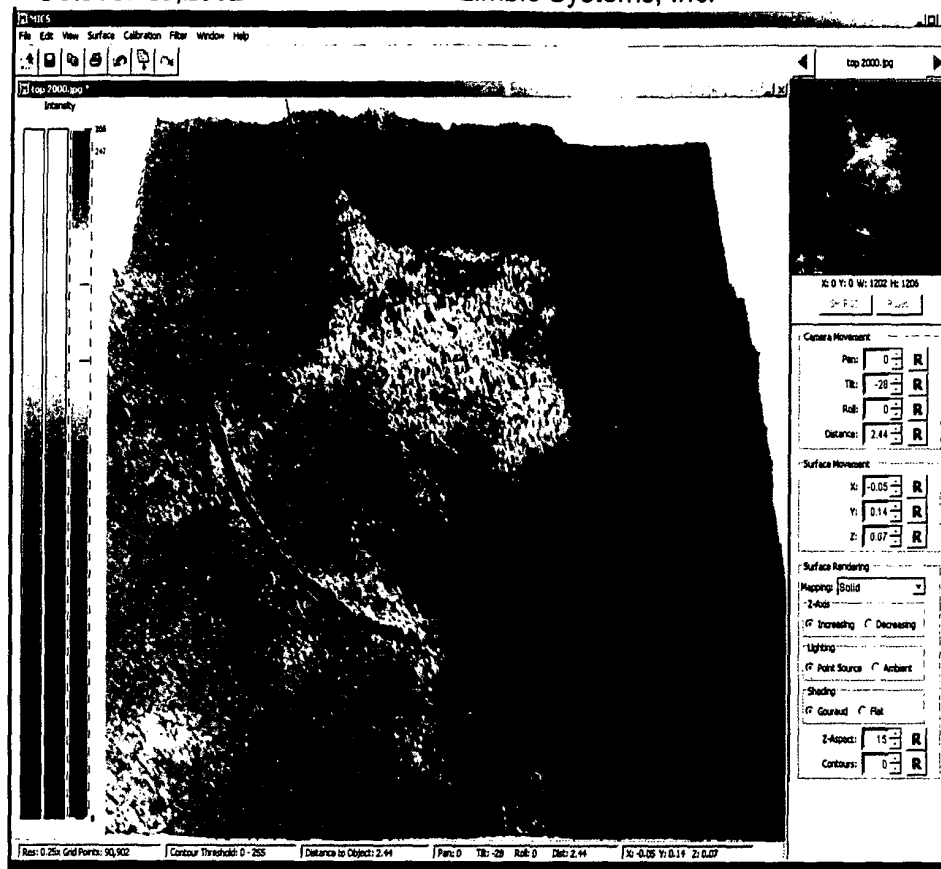




Overview of
Mammogram 1 Aug
2000

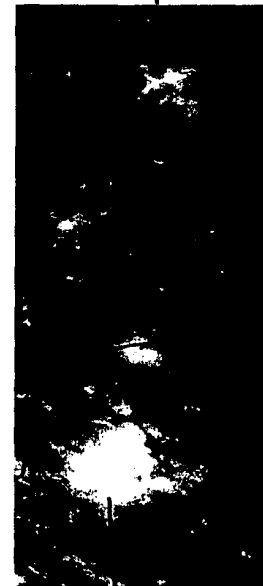

Cancer Lesion

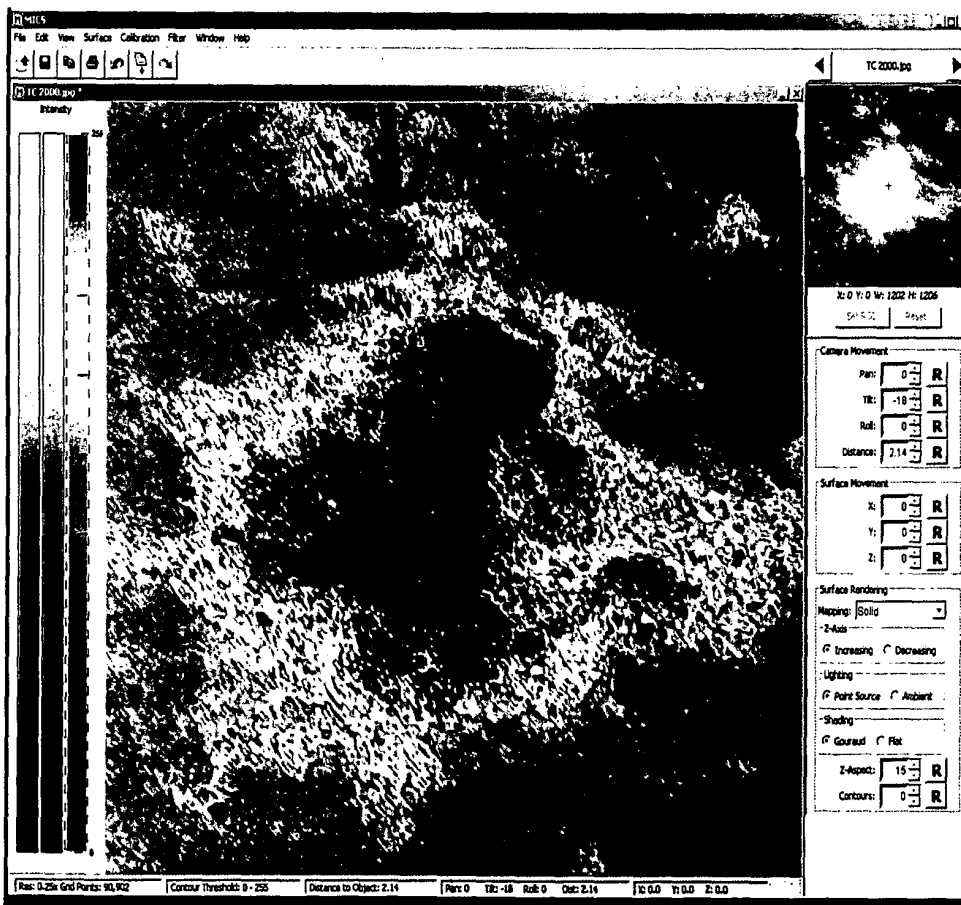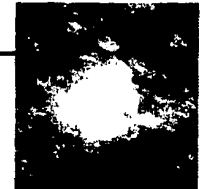

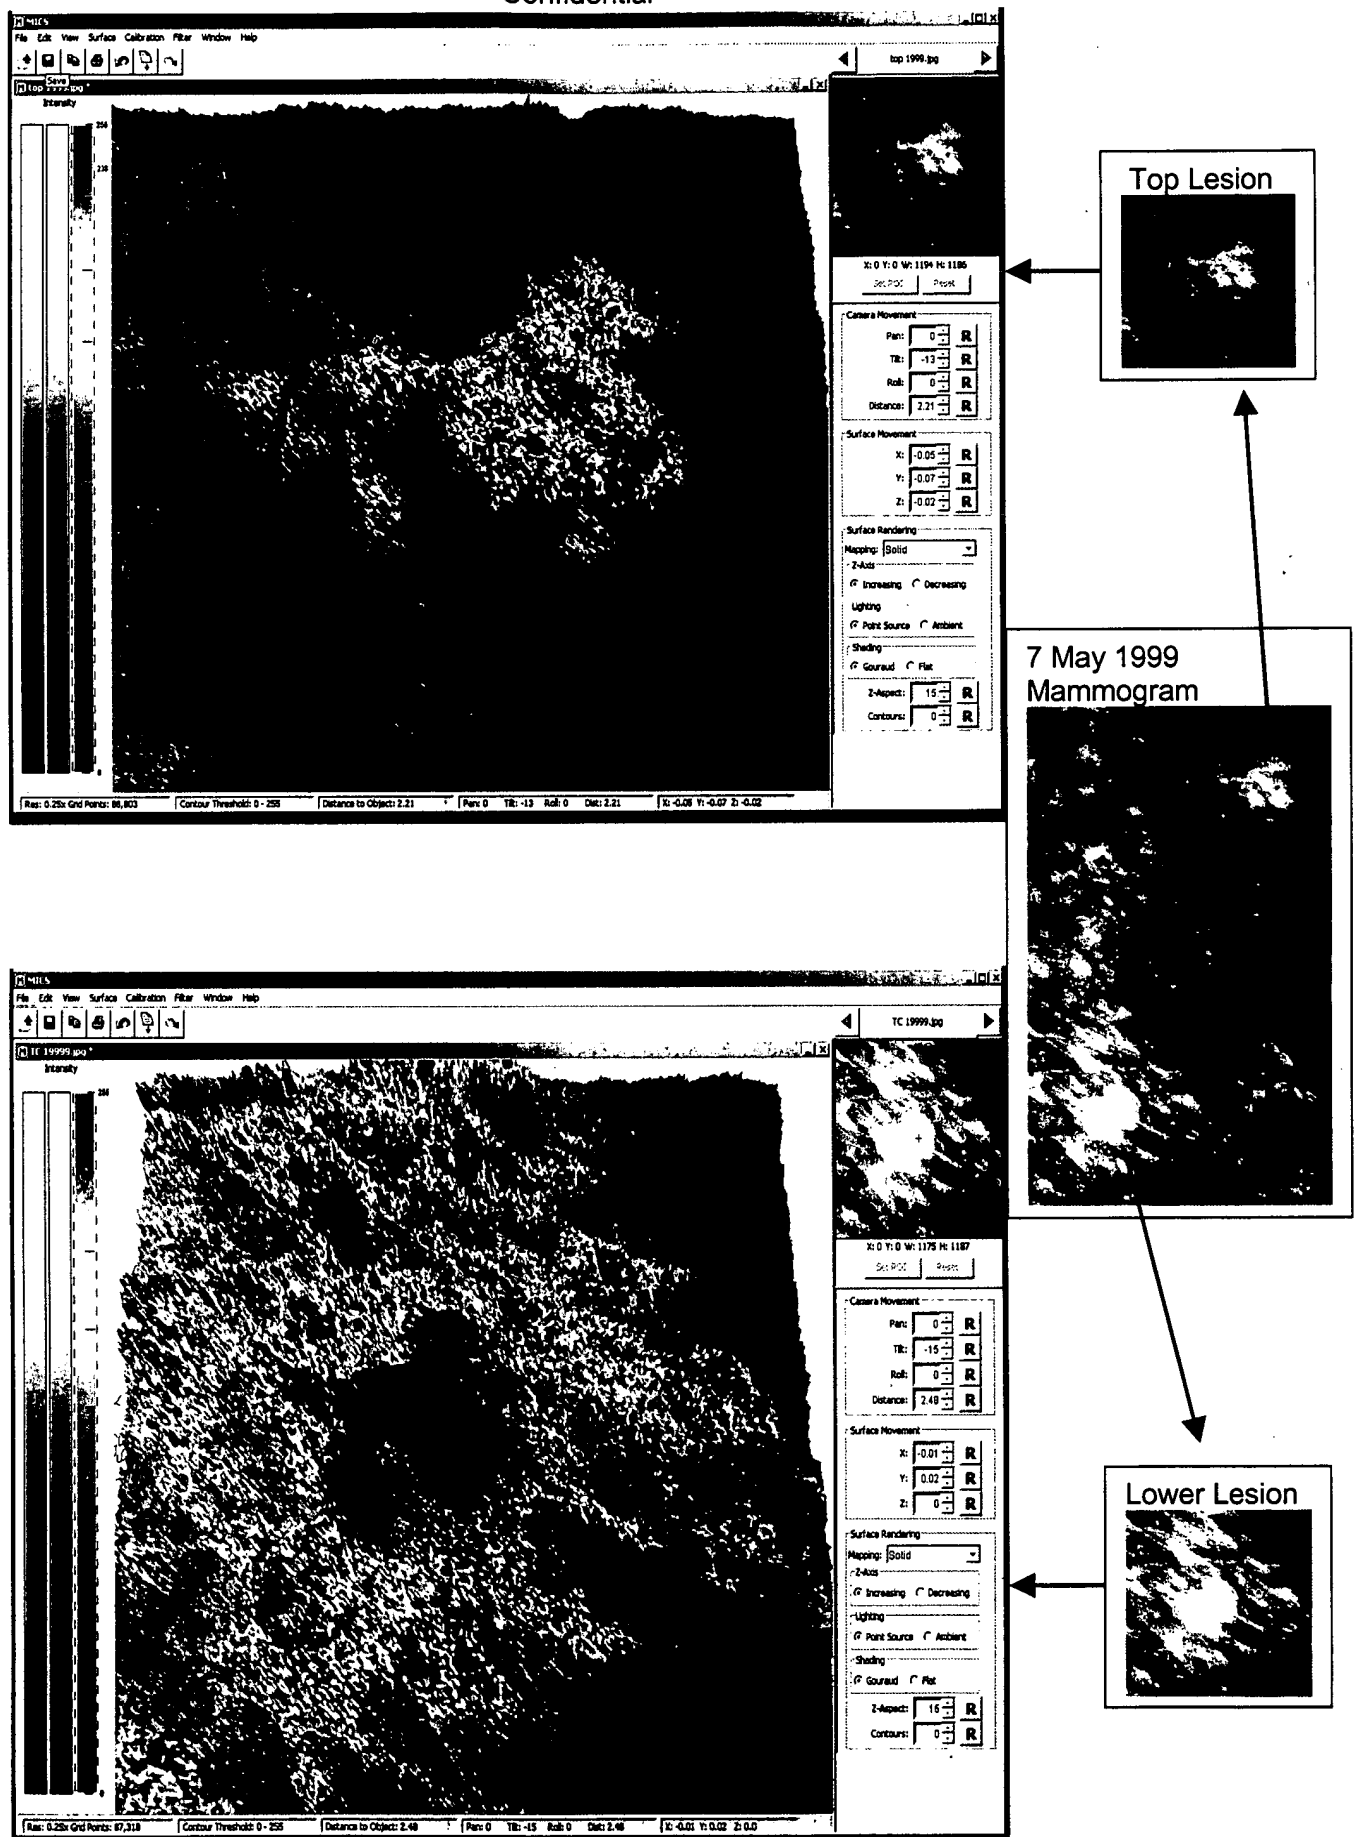

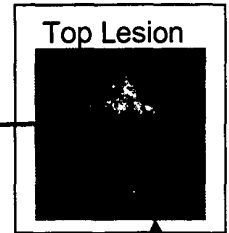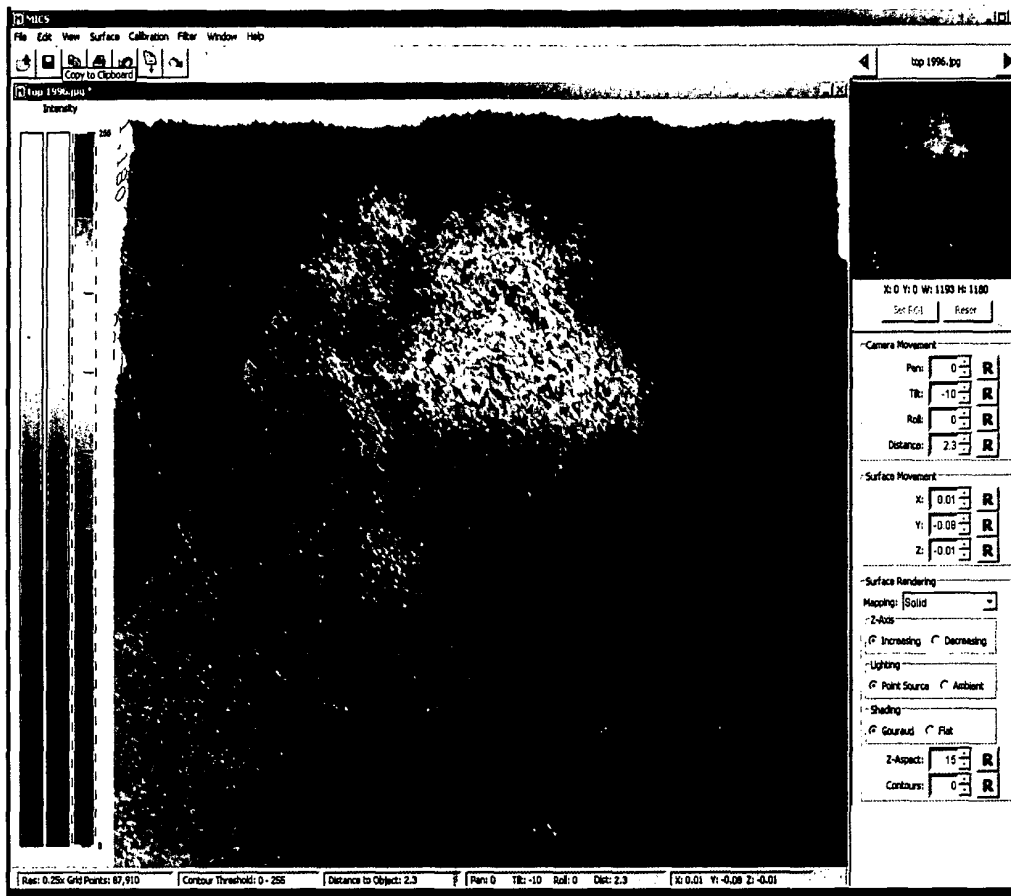

28 Feb 1996
Mammogram

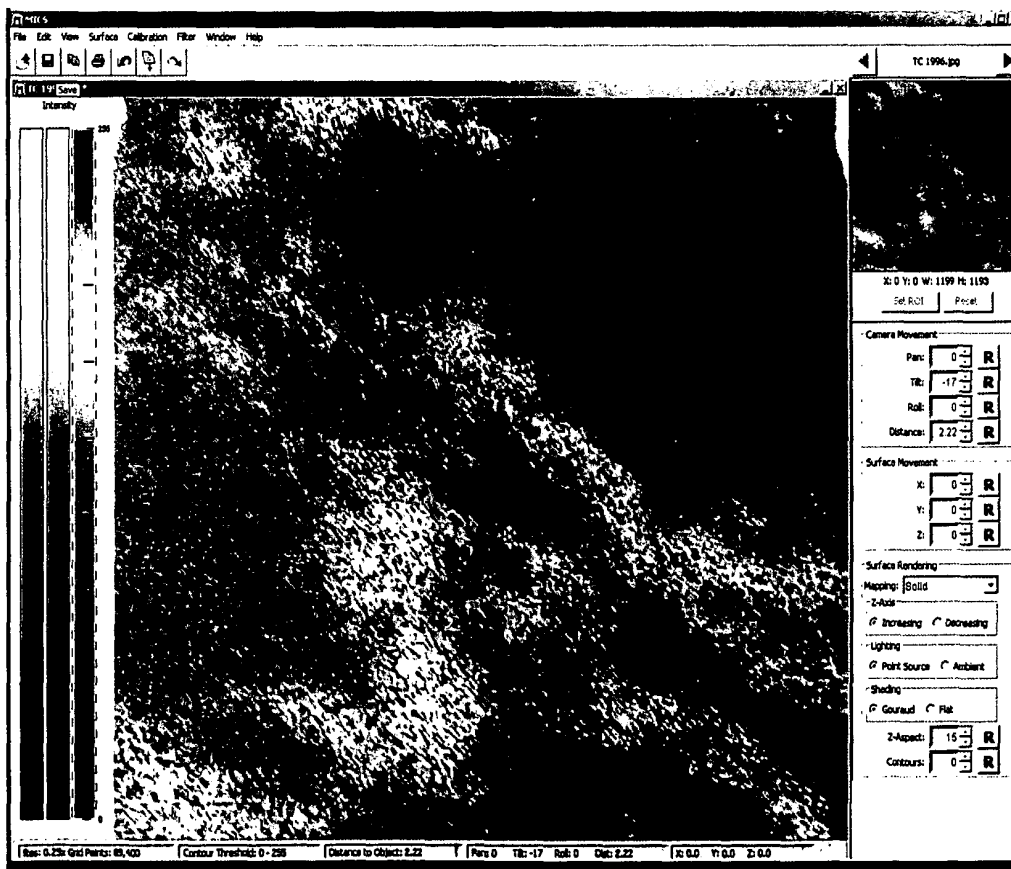
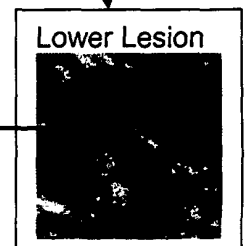
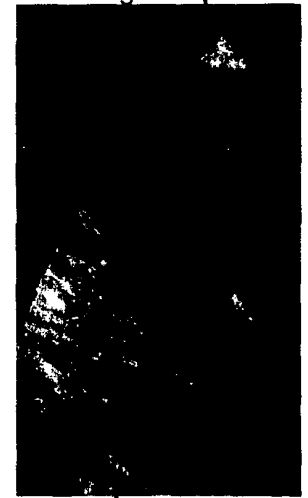


FIG. 40